


NOTE: Right and Left side of Motorcycle is determined while sitting on the bike.

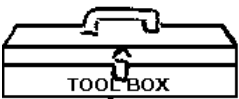

TOOLS REQUIRED:
 Torx Wrench, T25
 Torx Wrench, T30
 Wrench, 10mm

PARTS LIST

<u>Index</u>	<u>Description</u>	<u>Qty.</u>
1	Windshield, Lexan® FMR polycarbonate	1

PREPARATION

Note: retain all fasteners, as they will be reused.

1. Remove the rear view mirrors; refer to owner manual for turnsignal bulb replacement.
3. Remove the 8 screws holding the internal covering to the fairing. (Torx Wrench, T25.) **Figure 1 & 2.**



Figure 1



Figure 2



Figure 3

2. Release the brake and clutch hydraulic hoses from their clips. **Figure 3.**
3. Remove the internal covering from inside the fairing.
4. Remove the windshield (Torx Wrench, T30.) **Figure 4.**

Figure 4



INSTALLATION

1. Remove the mounting brackets from the windshield (Torx Wrench, T30 and Wrench, 10mm).

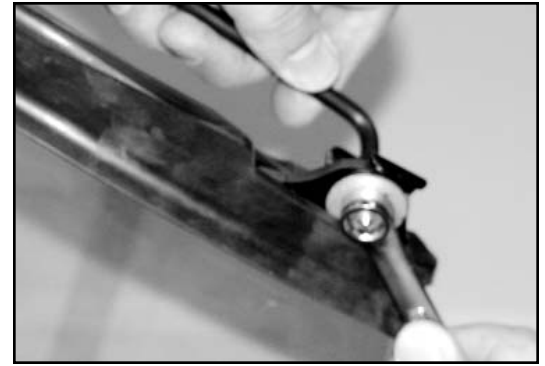


Figure 5

2. Remove the rubber gasket from the bottom of the windshield. It is held on by a non-curing adhesive along the front of the shield. **Note:** You want adhesive to stay on rubber. Only a trace will remain on shield. **Figure 6.**



Figure 6

3. Immediately install the rubber gasket onto the Z-Technik Windshield in the same manner that it was installed on the original shield. Be sure it is well seated and straight. **Figure 7.**



Figure 7

4. Install the mounting brackets onto the Z-Technik Windshield in the same manner that they were mounted to the original windshield. **Figure 8.**

5. Position the Z-Technik Windshield and start the screws. If necessary, adjust the angle of the mounting brackets so they align to the screw holes. Check that the rubber gasket is straight and well seated against the fairing. **Figure 9.** Tighten the screws firmly.

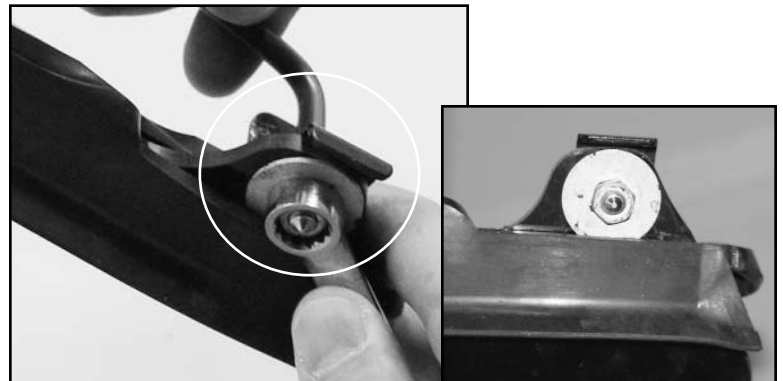


Figure 8

6. Re-install the internal covering.

7. Re-install the rear view mirrors.

MAINTENANCE

Cleaning: Wash with a clean soft cloth, plenty of warm water and, if necessary, a non-abrasive soap such as dishwashing liquid. Flannel or soft chamois make good cleaning cloths.

Paint, glue residue removal: Moisten cotton with a small amount of Naphtha or Turpentine **followed by a wash as above.** Apply a quality plastic cleaner, such as McGuir's Mirror-Glaze MG-17 to the screen. This will leave a protective coating on the screen making future cleanings easier. Do not clean polycarbonate in hot sun or high temperatures. Do not clean the screen with glass cleaners. Do not use rain protective products on the screen. The solvent action of the alcohol in these products will destroy the screen. Do not allow brake fluid, alcohol, or strong solvents to contact the screen.



Figure 9